

Churchill Claims Services

877-840-6277

Please Send SUPPLEMENT Requests to appraisals@churchill-claims.com
for REVIEW and to Obtain APPROVAL from the Claim's Payer PRIOR to Addl. Work

Date: 11/20/2025	Year: 2019
Reference #: 030040044394	Make: PETERBILT
Estimated By: Russell Meeks	Model: 579
Name: MGR TRUCKLINES	Unit #:
Address:	VIN: 1XPBDP9X7KD489965
City/State/Zip: ,	Style: MDHD: Conventional
Phone: - -	Plate/State: -
Inspected Date:	WMI: FIN:
Claimant:	Odometer:
Date of Loss:	Color:
Claim Contact:	Date Of Loss:
Contact Title:	Inspected At:
Contact Phone: x	Claim Number: 312.7-Tractor
Contact Email:	File Number: 8180948

Total Loss

Operation	Description	Part #	Type	Labor	Paint	-----Parts-----		Misc
----- Front Bumper (3-Piece) -----								
1	Replace	BUMPER PETERBILT 579,FOG,TOW,16" (Aftermarket)	ABP N31 0HZ501016Y	A/M	1.50	2.80	1 @ \$611.41	\$611.41
2		Non-Adjacent Overlap		Adj		-0.20		
3		R&I License Plate		AddLbr	0.10			
4	Replace	Bumper Support (Left)		New	0.30		1 @ \$249.90	\$249.90
5	Replace	Fog Lamp (Left)		New	0.30		1 @ \$211.62	\$211.62
----- Grille -----								
6	Replace	Grille Assembly	P-67265	LKQ Incl			1 @ \$1,312.48	\$1,312.48
7	Replace	Grille Surround		New	0.50		1 @ \$1,838.46	\$1,838.46
8	Replace	Grille Screen		New	0.80		1 @ \$996.92	\$996.92
9	Replace	Bug Screen		New	0.50		1 @ \$155.11	\$155.11
10	Replace	Vertical Grille Reinforcement	Serviced with Hood	New	0.30		1 @ \$325.61	\$325.61
11	Replace	Emblem		New	0.20		1 @ \$370.00	\$370.00
12	Replace	Hood Handle		New	0.20		1 @ \$157.11	\$157.11
----- Hood (Long-Hood) -----								
13		Paint Overhaul Hood (Long-Hood)		Ovhl		7.00		
14	Replace	Hood Shell (Long-Hood)	R12190539	LKQ Ovhl	8.00		1 @ \$6,000.00	\$6,000.00
15		Drill for Fender Emblems		AddLbr	0.40			
16		Aim Head Lamps		AddLbr	0.50			
17		Drill for Fender Mirrors, Dual		AddLbr	0.60			
18		Add to R&I Dual Fender Mounted Mirrors		AddLbr	0.60			
19	Replace	Grille Opening Reinforcement		New	3.50		1 @ \$818.31	\$818.31
20	Replace	Headlamp Reinforcement (Left)		New	2.00		1 @ \$706.77	\$706.77
21	Replace	Hood Pivot Assembly	674-10385	New	2.00		1 @ \$1,843.90	\$1,843.90
22	Replace	Hood Tilt Assist Bracket (Left)		New Incl			1 @ \$345.00	\$345.00
23	Replace	Hood Tilt Assist Bracket (Right)		New Incl			1 @ \$345.00	\$345.00

Date:11/20/2025Reference #:030040044394Estimated By:Russell MeeksName:MGR TRUCKLINES

Year:2019Make:PETERBILTModel:579Unit #:

Operation		Description	Part #	Type		Labor	Paint	-----Parts-----	Misc
24	R&I	Hood Assist Cylinder Mounting (Left)				0.80			
25	R&I	Hood Assist Cylinder Mounting (Right)				0.80			
26	R&I	Hood Assist Cylinder (Left)				0.20			
27	R&I	Hood Assist Cylinder (Right)				0.20			
28	R&I	Hood Support Guide (Left)							
29	R&I	Hood Support Guide (Right)							
30	R&I	Splash Shield (Left)				1.00			
31	R&I	Splash Shield (Right)				1.00			
32	R&I	Hood Mounted Splash Shield (Left)				1.00			
33	R&I	Hood Mounted Splash Shield (Right)				1.00			
34	R&I	Splash Shield Support (Left)				0.50			
35	R&I	Splash Shield Support (Right)				0.50			
36	Replace	Headlamp Assembly (Left)	40824-20	New	Incl			1 @ \$1,050.00	\$1,050.00
----- Cooling -----									
37	Replace	Radiator Assembly	2401893LW (Quote_#50259975)	A/M		M 4.00		1 @ \$1,436.73	\$1,436.73
38	Replace	Add Radiator Core Charge		Mtrls	AddPrt				
39	Replace	Antifreeze, Extended Duty		Mtrls	AddPrt				
40		Charge A/C			AddLbr M	1.40			
41		Recover Freon			AddLbr M	0.30			
----- A/C & Heater -----									
42	Replace	Condenser	ABP N83 306042	A/M		M 1.00		1 @ \$497.28	\$497.28
43	Replace	Freon - 134a		Mtrls	AddPrt				
----- Cab Assembly, w/Sleeper -----									
44	Replace	Cowl Side Panel, Outer (Left)	22-6152	New		2.00	1.30	1 @ \$218.93	\$218.93
45	Replace	Cowl Side Panel, Inner (Left)		New		6.00	2.00	1 @ \$318.21	\$318.21
----- Frame -----									
46	Replace	Set Up and Measure Frame	Heavy Duty Truck	New		F 3.50			
47	* Repair	Pull to Align Frame Rails (Mash)				F 8.00			
----- Calculated Values -----									
48	^	Hazardous Waste							
49	^	Two stage paint.					3.40		
50	^	Paint Materials		Mtrls					\$1,015.00

An '*' indicates user change of database part and '^' indicates manually entered or custom database rows.

Estimate Notes:

Date: 11/20/2025
Reference #: 030040044394
Estimated By: Russell Meeks
Name: MGR TRUCKLINES

Year: 2019
Make: PETERBILT
Model: 579
Unit #:

Summary	Amount	Rate	Disc	Total
Body Labor	37.3	\$150.00	0.00%	\$5,595.00
Paint Labor	16.3	\$150.00	0.00%	\$2,445.00
Mechanical	6.7	\$175.00	0.00%	\$1,172.50
Frame	11.5	\$150.00	0.00%	\$1,725.00
Misc. Labor	0.0	\$0.00	0.00%	\$0.00
Parts	\$19,808.75		0.00%	\$19,808.75
Misc.				\$1,015.00
Sub-total				\$31,761.25
Sales Tax				1,457.66

State (Parts, Materials)
\$20,823.75 @ 7.0000%: \$1,457.66

Total	\$33,218.91
Betterment	\$0.00
Deductible	\$0.00
Grand Total	\$33,218.91

Repair Facility:
Address:

Phone: () -
Email:
Agreed With:
License 1:
License 2:
Fed Tax ID:
Registration #:

Appraised By:
License #1:
License #2:
Phone:
Email:

Alternate Parts Summary

Description	Part Type	Supplier	Phone	Email
BUMPER PETERBILT 579,FOG,TOW,16" Aftermarket (Aftermarket)		Alliance Truck Parts		Contact Local Dealer
Grille Assembly	LKQ	Complete Recycling Group LLC	(410) 920-5505	leads@complete-recycle.com
Hood Shell (Long-Hood)	LKQ	Spalding Auto Parts	(800) 366-2070	heavytrucks@spaldings.com
Radiator Assembly	Aftermarket	1-800-RADIATOR: Please go back and quote using zip	(800) 723-4286	ServiceCentral@1800radiator.com
Condenser		Contact your local Daimler dealer		

Date:	11/20/2025	Year:	2019
Reference #:	030040044394	Make:	PETERBILT
Estimated By:	Russell Meeks	Model:	579
Name:	MGR TRUCKLINES	Unit #:	


Date:	11/20/2025	Year:	2019
Reference #:	030040044394	Make:	PETERBILT
Estimated By:	Russell Meeks	Model:	579
Name:	MGR TRUCKLINES	Unit #:	


TERMS & CONDITIONS

Signed _____ Date _____







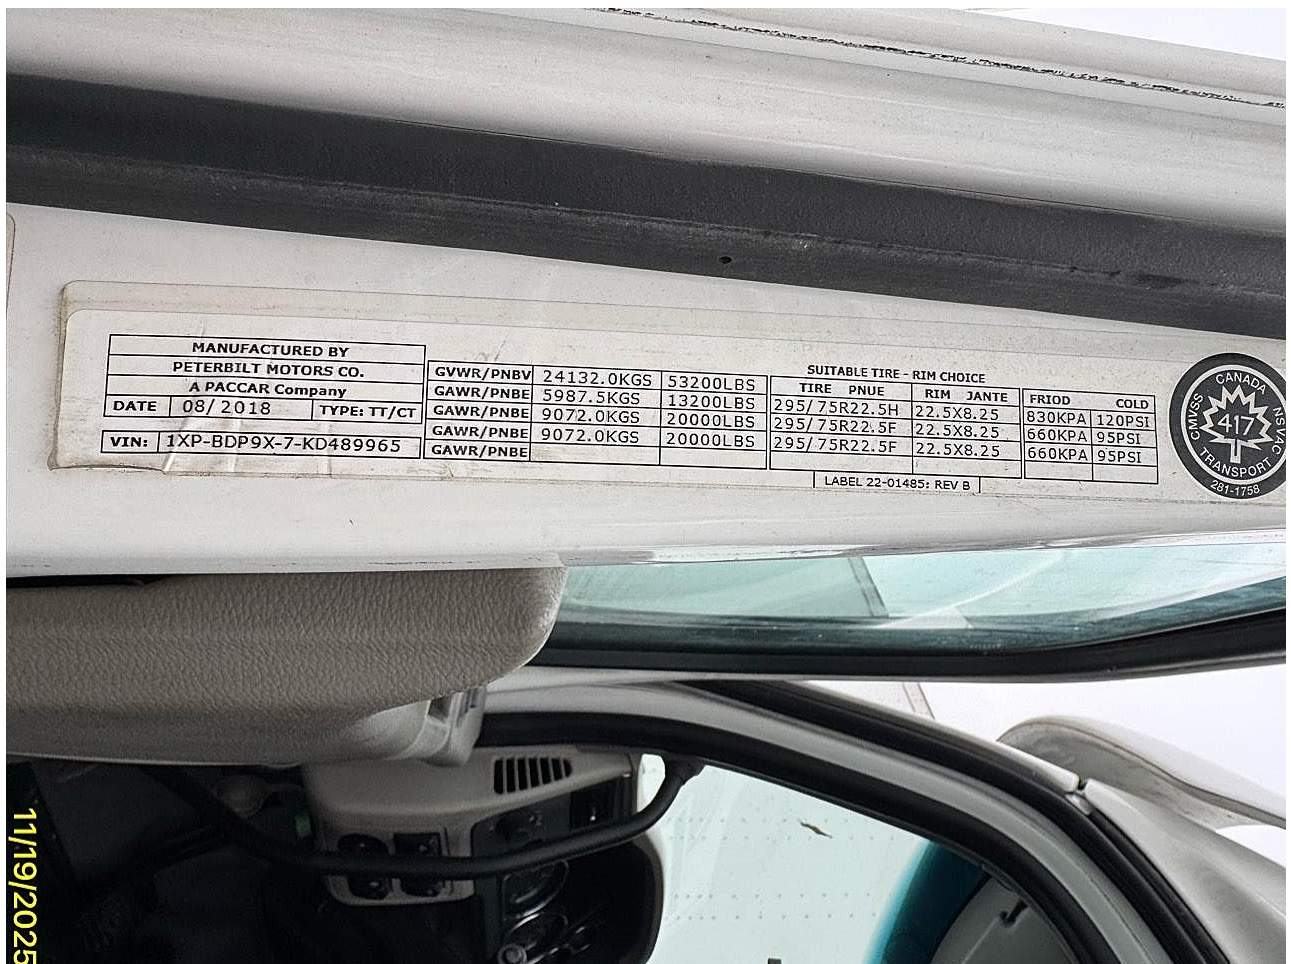

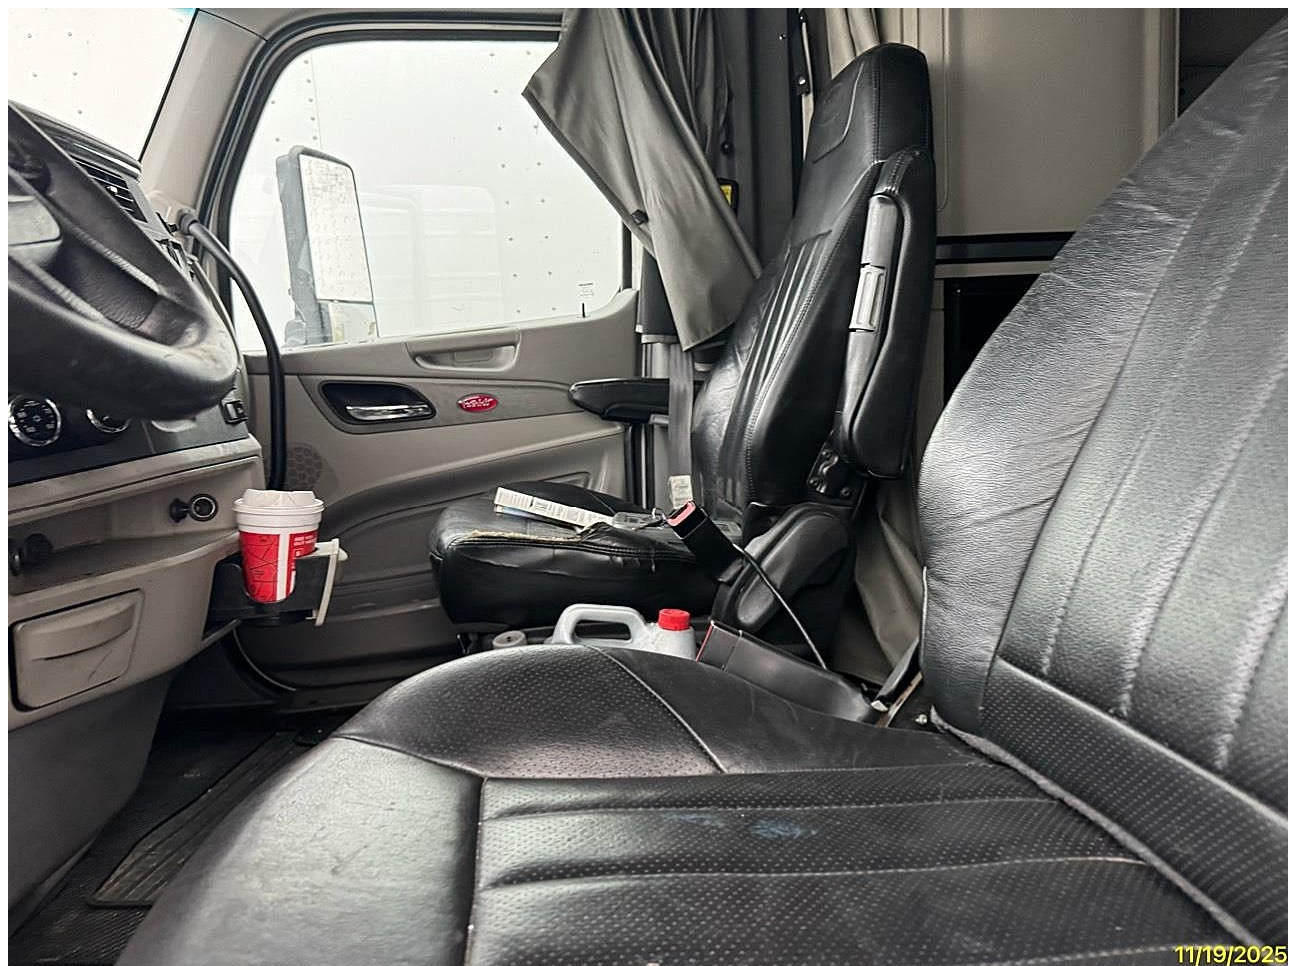



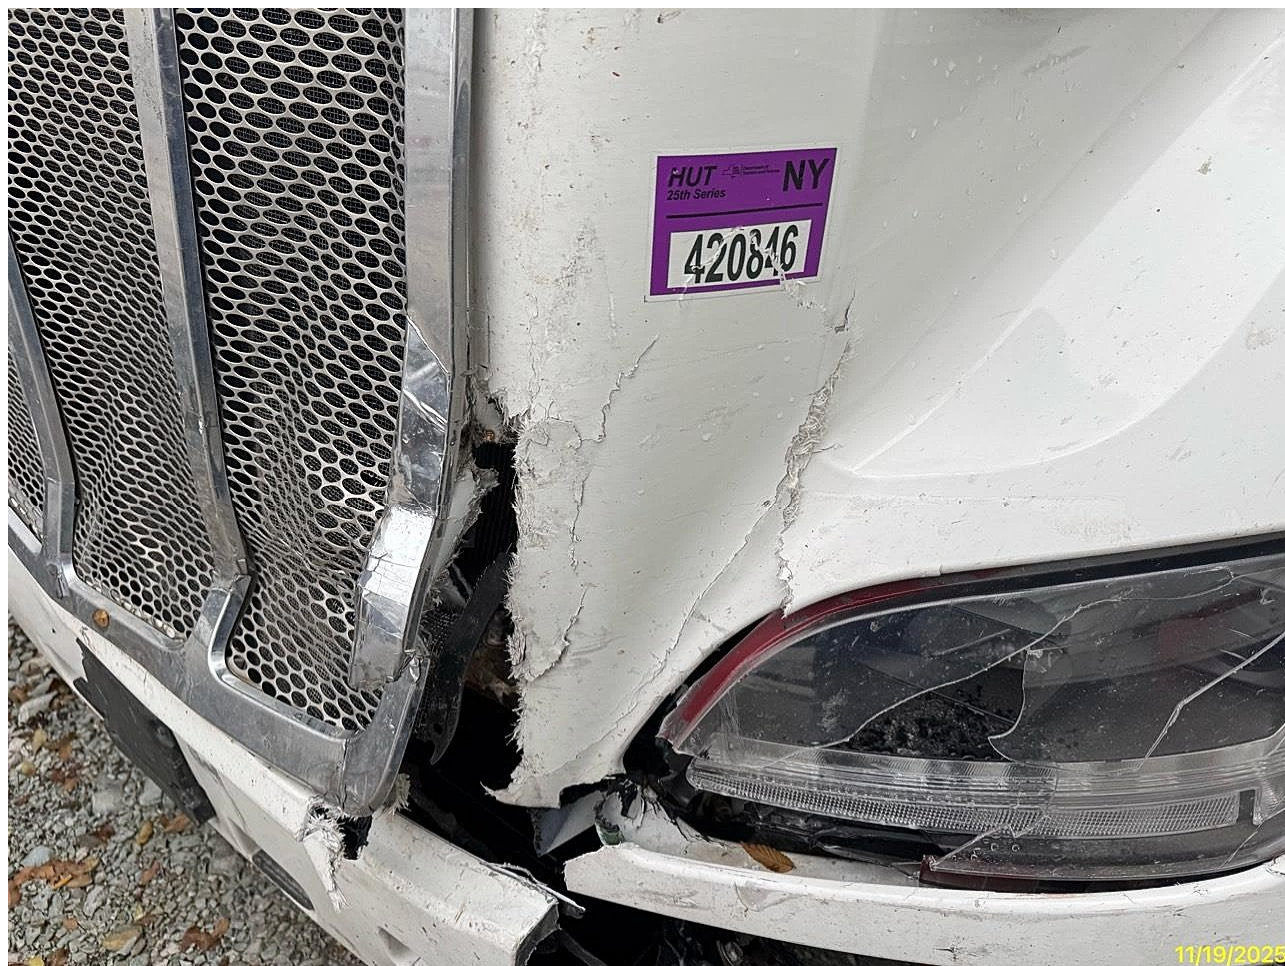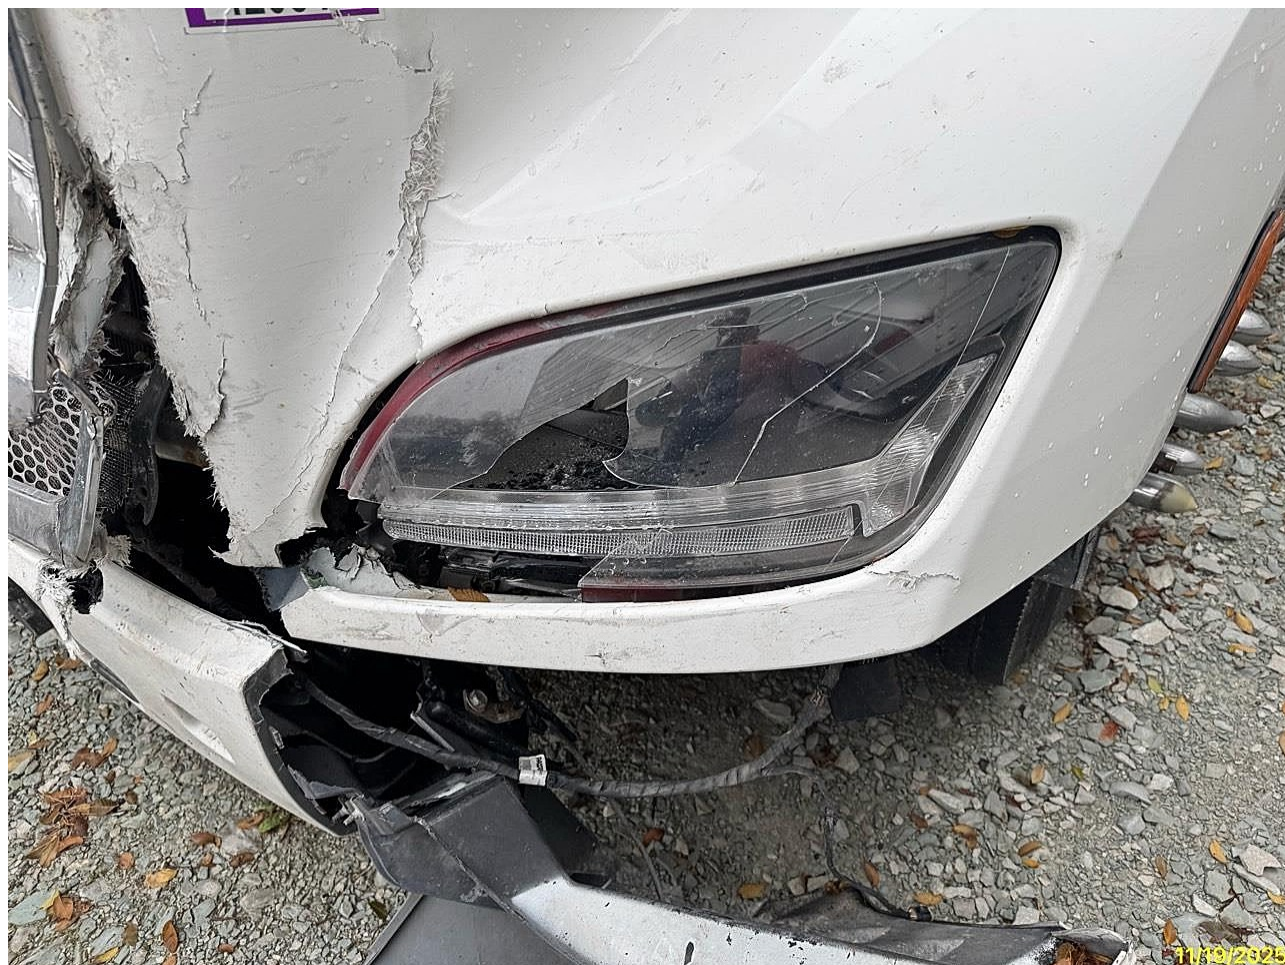



11/19/2025



11/19/2025

